



Windshield Wipers Chatter

(Supersedes 07-015, dated May 4, 2007; see Revision Summary)

REVISION SUMMARY

This service bulletin has been revised extensively; American Honda recommends that you review the entire bulletin.

SYMPTOM

The windshield wiper blades chatter when used.

PROBABLE CAUSE

The blade pressure against the windshield is weak.

CORRECTIVE ACTION

Replace the original windshield wiper blade assemblies with new plastic blade assemblies.

PARTS INFORMATION

Wiper Blade Set: P/N 76660-SEC-305
(Includes left and right wiper blade assemblies.)

NOTE: When replacing individual wiper blade assemblies or wiper inserts for the new plastic style blades, use the following part numbers.

Left Wiper Blade: P/N 76620-SEC-305

Left Wiper Insert: P/N 76622-STK-A01

Right Wiper Blade: P/N 76630-SEC-306

Right Wiper Insert: P/N 76632-SEC-305

NOTE: When replacing original rubber wiper blade parts, use the following part numbers.


Left Wiper Blade: P/N 76620-SEA-G11

Left Wiper Insert: P/N 76622-SEA-J11


Right Wiper Blade: P/N 76630-SEC-A11

Right Wiper Insert: P/N 76632-SEC-A11

REPLACEMENT PLASTIC BLADES

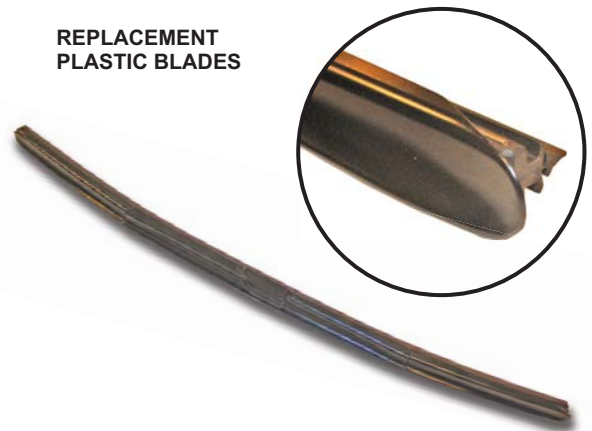

ORIGINAL RUBBER BLADES

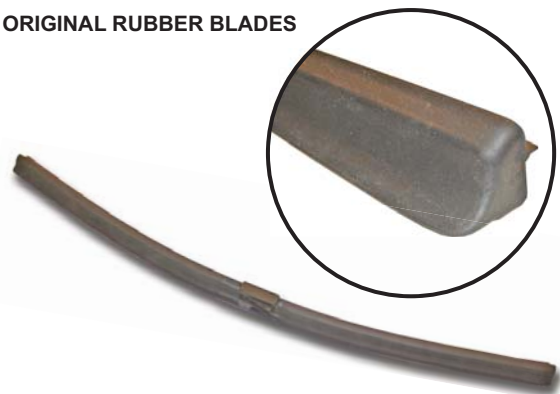

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by “do-it-yourselfers,” and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number: 7401C8

Flat Rate Time: 0.2 hour

Failed Part: P/N 76620-SEA-G11


Defect Code: 03214

Symptom Code: 04209

Skill Level: Maintenance Technician

REPAIR PROCEDURE

1. Pull up the wiper arms from the windshield.
2. Press and hold the lock tab, then slide the blade assembly toward the lock tab until it releases from the wiper arms.

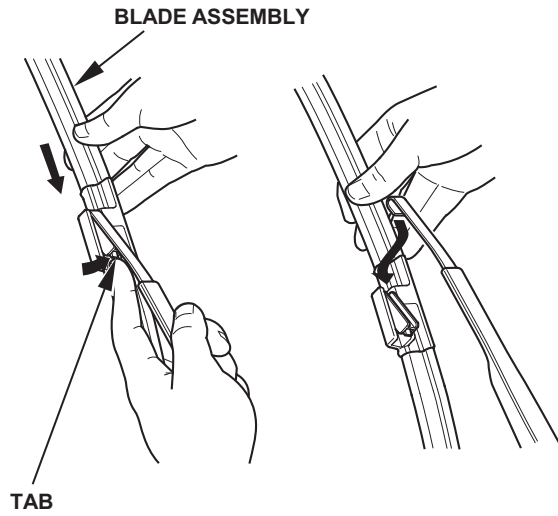

3. Install the new wiper blade assemblies.