

YEAR  
1995 - 96  
1996

MODEL  
2.5TL  
3.2TL

VIN APPLICATION  
See VEHICLES  
AFFECTED

BULLETIN NO.  
**95-023**



## Key Stuck in the Ignition Switch

### SYMPTOM

The key cannot be removed from the ignition switch even though the shift lever is firmly in Park.

### PROBABLE CAUSE

The pin on the shift lever does not fully engage the parking pin switch. Because of this, the switch does not deactivate a solenoid in the ignition switch that allows the key to be removed.


### VEHICLES AFFECTED

1995 2.5TL: All  
1996 2.5TL: Thru VIN JH4UA2...TC010463  
1996 3.2TL: Thru VIN JH4UA3...TC000084


### CORRECTIVE ACTION

Adjust the parking pin switch.

1. Remove the center console.

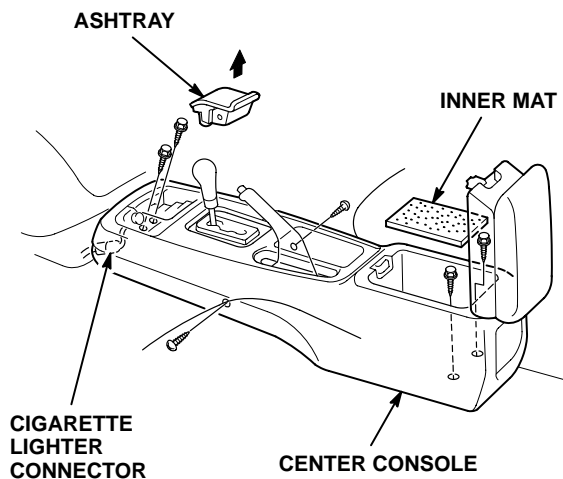

2. Loosen the parking pin switch mounting screw. Rotate the switch counterclockwise as far as it will go (about 0.5 mm), then tighten the mounting screw.

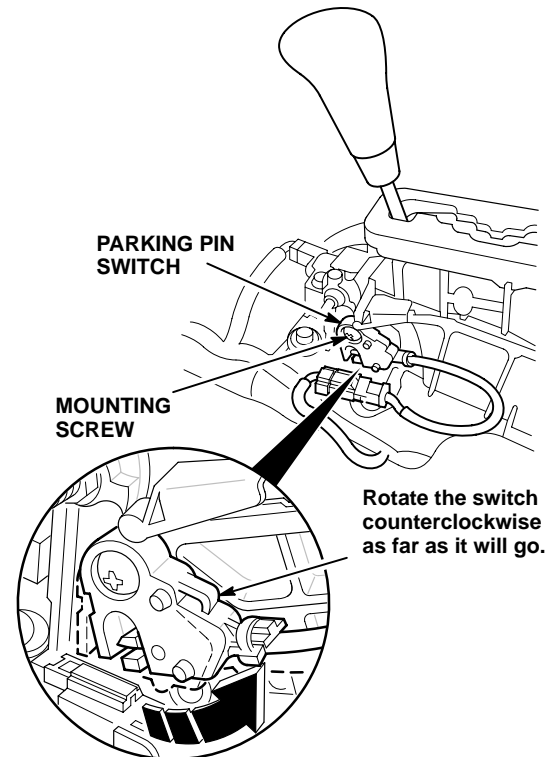

3. Reinstall the center console.

### WARRANTY CLAIM INFORMATION

**In warranty:** The normal warranty applies.

**Out of warranty:** Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Technical Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

Operation number: 743320  
Flat rate time: 0.5 hour  
Failed P/N: 54026-SW5-980  
Defect code: 074  
Contention code: B01