

YEAR
1995 – 96
1996

MODEL
2.5TL
3.2TL

VIN APPLICATION
ALL with
ACCESSORY
MOONROOF VISOR

BULLETIN NO.
96-037



Wind Noise From the Moonroof

SYMPTOM


With the moonroof closed, a whistling noise comes from that area at highway speeds.

PROBABLE CAUSE

The mounting clips do not clamp the accessory moonroof visor tightly, allowing it to lift at highway speeds.

CORRECTIVE ACTION

Replace the moonroof visor clips and mounting hardware with the new parts in the kit listed under PARTS INFORMATION.

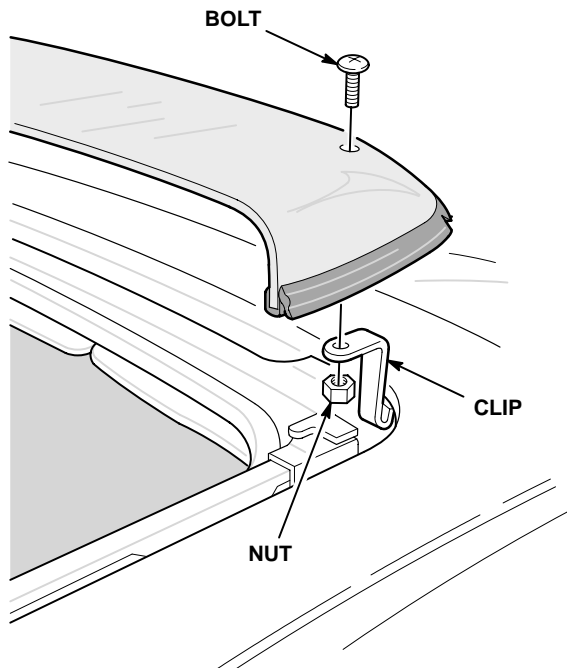

PARTS INFORMATION

Moonroof Visor Clip Kit: P/N 08R01-SW5-200R1

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation number: 040106

Flat rate time: 0.2 hour

Failed P/N: 08R01-SW5-200

Defect code: 056

Contention code: B07

Template ID: 96-037A

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Technical Manager or your Zone Office. You must request consideration, and get a decision, before starting work.