

## Pop Coming from Both Sides of the Rear Roof Area

### AFFECTED VEHICLES

Year	Model	Trim Level
2019–22	RDX	ALL

We are getting reports of a popping noise coming from the left and right sides of the rear area of the roof near the panoramic sunroof assembly.

Before replacing the sunroof frame assembly to address the noise, do a mounting bolt retorque procedure. Then, verify if the noise is still present before replacing the frame assembly.

Follow the service information procedure, **Headliner Area Removal** to remove the headliner. Once the headliner is removed, all 20 sunroof assembly bolts will be accessible. Then, by following the torque pattern below, make sure each bolt is torqued to spec **9.4 N.m (6.9 ft-lb)**.

