



2004–06 TL: Front Brakes Squeal

(Supersedes 07-005, dated January 27, 2007, to revise the information marked by the black bars)

REVISION SUMMARY

Under WARRANTY CLAIM INFORMATION, the flat rate time was revised after the operation was reviewed and validated.

SYMPTOM

The front brakes squeal.

PROBABLE CAUSE

Improper brake pad material

CORRECTIVE ACTION

Install new brake pads, and refinish the brake discs.

PARTS INFORMATION

Front Brake Pad Set: P/N 45022-SEP-A01

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number: 410820

Flat Rate Time: 0.9 hour

Failed Part: P/N 45022-SEP-A00

Defect Code: 07701

Symptom Code: 04212

Template ID: 07-005A

Skill Level: Repair Technician

REPAIR PROCEDURE

1. Remove the old front brake pads:
 - Refer to page 19-14 of the *04–06 TL Service Manual*, or
 - Online, enter keyword **PAD**, and select **Front Brake Pad Inspection and Replacement** from the list.
2. Inspect the front brake discs:
 - Refer to page 19-17 of the service manual, or
 - Online, enter keyword **FRONT DISC**, and select **Front Brake Disc Inspection** from the list.
3. Refinish the brake discs using an on-car brake lathe. Refer to Service Bulletin 00-037, *Brake Disc Refinishing Guidelines*.
4. Test-drive the vehicle to make sure the problem is eliminated.